
XH3/XH4/XH2 Half-pitch Connectors Series

1.27-mm Contact Pitch Greatly Contributing to High-density Mounting of Electronic Components and Miniaturization of Electronic Devices

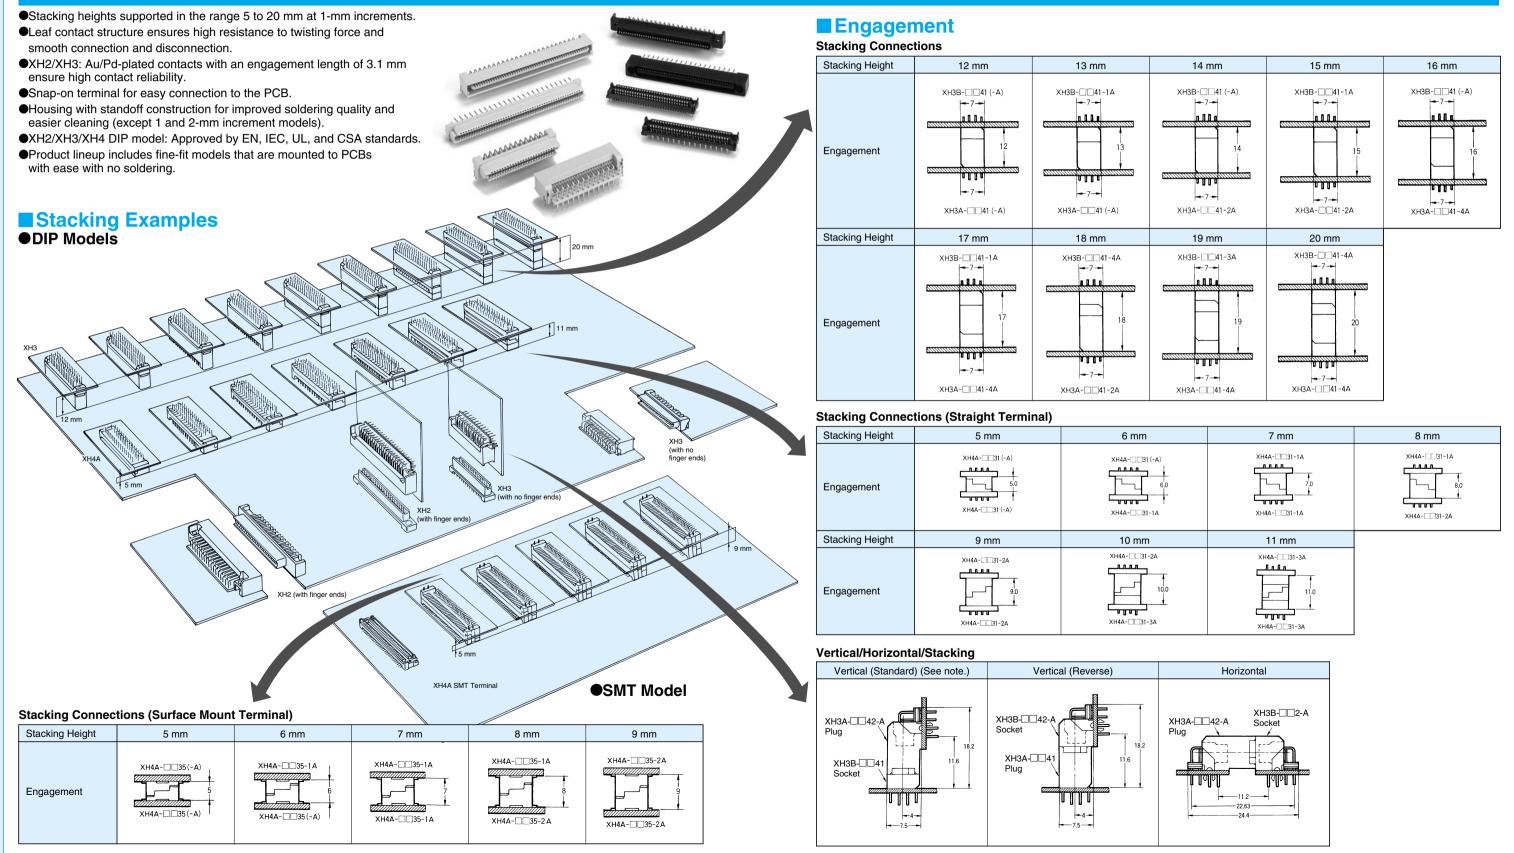

12

XH3/XH4/XH2 Half-pitch Connectors Series

Connection Examples •Multi-tier Stacking of Fine-fit Models

•Fine Fit


The term " fine fit " (generally known as " press fit ") refers to the technique where the connector terminal are pressed into the through holes of the PCB to connect the PCB and connector electrically and mechanically with the spring pressure of the terminal. The connector is connected with no solder, eliminating the

soldering stage usually required with connectors. Furthermore the PCB is free of thermal load or flux, thus contributing to cost

reductions and improvements in contact reliability. _____


Engagement


•Stacking Fine-fit Plain Models with Straight Terminal

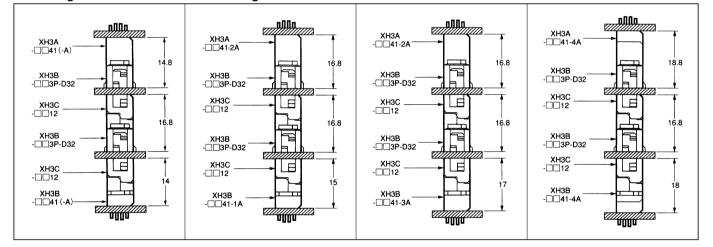


Ordering Information

•XH3 Half-pitch Connectors (Fine-fit and Stacking Connection)

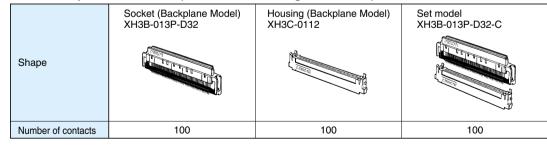


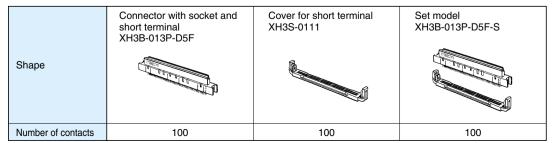


●XH3 Half-pitch Connectors (Board-to-Board Connection) Plugs

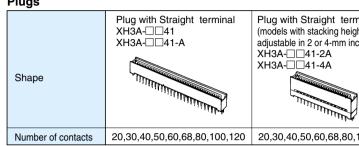



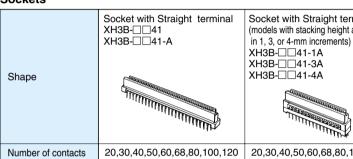

●XH4 Half-pitch Connectors (Low-profile Stacking Connection)

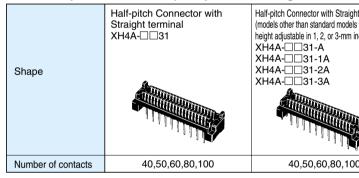

minal pht crements)	Plug with Right angle terminal XH3A-042-A
100,120	30,40,50,60,68,80,100

rminal adjustable)	Socket with Right angle terminal (Provided with Lock Terminal) XH3B-□□42-A
]	
100,120	30,40,50,60,68,80,100
n)	

,	
ht terminal s with stacking increments)	Half-pitch Connector with SMT (models other than standard models with stacking height adjustable in 1 or 2-mm increments) XH4A
0	40,50,60,80,100